

TECHNICAL BULLETIN # EC - 06

DATE:

FEBRUARY 9, 1998

MODEL YEAR:

1992 AND AFTER

CHASSIS MODEL: ENGINE MODEL: UD1300/UD1400 TD42T/TD42TI

BULLETIN #:

EC - 06

FILE IN THE ENGINE SECTION OF THE TECHNICAL BULLETIN BINDER


TD42T AND TD42TI COOLING SYSTEM FILLING INSTRUCTIONS

PURPOSE:


To inform the UD Truck Service Technician of the proper filling instructions for the TD42T and TD42TI cooling system. These instructions are also to be used while performing EUP - 1.

SERVICE NOTICE:


- 1. Observe all safety precautions for the engine cooling system. Remove the radiator cap.
- Remove the turbocharger coolant inlet tube eye bolt with a 22mm socket. Replace the copper gaskets with part number 01351-21164 (2 req'd) but do not retighten the eye bolt.
- 3. Fill the cooling system with the proper coolant solution through the radiator fill neck until it flows out through the turbocharger cooling line connection, then tighten the eye bolt.
- 4. Continue to fill the cooling system to the top of the radiator fill neck. Reinstall the radiator cap.
- 5. Add coolant solution to the "MAX" level of the coolant reservior tank as shown in the illustrations below.

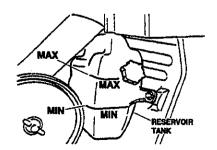

1992 - 1993 UD1300

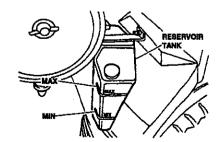

UD1400 UP TO OCTOBER, 1993

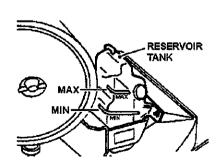

GASKETŠ, 2 EA.

P/N 01351 - 21164

TURBOCHARGER

COOLANT

INLET TUBE

EYE

BOLT

UD1400 AFTER OCTOBER, 1993