

NISSAN DIESEL AMERICA, INC.

TECHNICAL BULLETIN EN-33

DATE: JULY 21, 2005
 MODEL YEAR: 2005 & AFTER
 ENGINE MODEL: J05 & J08
 CHASSIS MODEL: UD1300 ~ UD3300
 BULLETIN NUMBER: EN-33
FILE IN THE ENGINE SECTION OF THE TECHNICAL BULLETIN BINDER

2005 & AFTER J05 & J08 CRANKCASE VENT TUBE MODIFICATION

PURPOSE

To advise that the crankcase vent tube has been modified to prevent snow and ice accumulation in this hose on engines manufactured during June 2005 and after.

CHANGE NOTICE


The crankcase vent tube has been modified to include a diagonal cut at the hose end (Fig. A) and a 2 1/2 inch long slit as shown in Fig. B.



Figure A



Figure B

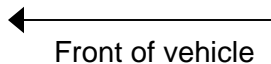

The modifications to the Crankcase vent tube will begin at the factory with the following engine serial numbers:

J08E-TE – 12089 J05D-TA – 13650

RECOMMENDATION

Crankcase vent tubes on engines prior to the above mentioned serial numbers that operate in the Northern and Midwestern states can be modified at customer expense to reduce the possibility of snow and ice accumulation in the breather hose as shown.

THE INFORMATION CONTAINED IN THIS BULLETIN SHOULD NOT BE INTERPRETED AS THE BASIS FOR WARRANTY CLAIMS							
FOR THE INDICATED PERSONNEL BELOW, PLEASE READ, INITIAL, AND ROUTE TO THE FOLLOWING:							
X	SERVICE MANAGER	X	WARRANTY MANAGER	X	SERVICE TECHNICIANS INITIAL BELOW:		
X	PARTS MANAGER	X	SHOP FOREMAN				